

JMS578固件分位更新 (适用3139U3、6139U3、7688U3、MD35U3)

解决的问题：

1. 使用大于2TB容量硬盘（有数据资料）不能正常识别，显示为GPT保护分区；
 2. 使用大于2TB容量硬盘（有数据资料）提示需要初始化硬盘；
-


JMS578_Firmware Update_ (For 3139U3、6139U3、7688U3、MD35U3)

Be applicable：

1. Use hard disk with a capacity greater than 2TB, (There are data files) Can not be properly identified, shown as GPT protected partition.
2. Use hard disk with a capacity greater than 2TB (There are data files) Prompt to initialize the hard disk


步骤一：打开“Tool”文件夹，运行“JMMassProd2_v1_16_14_25.exe”程序。

Step 1, Open the "Tool" folder and run the " JMMassProd2_v1_16_14_25.exe " program.

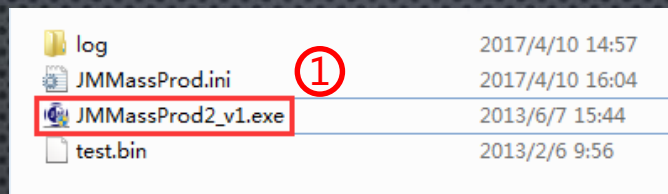

步骤二：勾选上“RD Version”。

Step 2, Check the "RD Version"

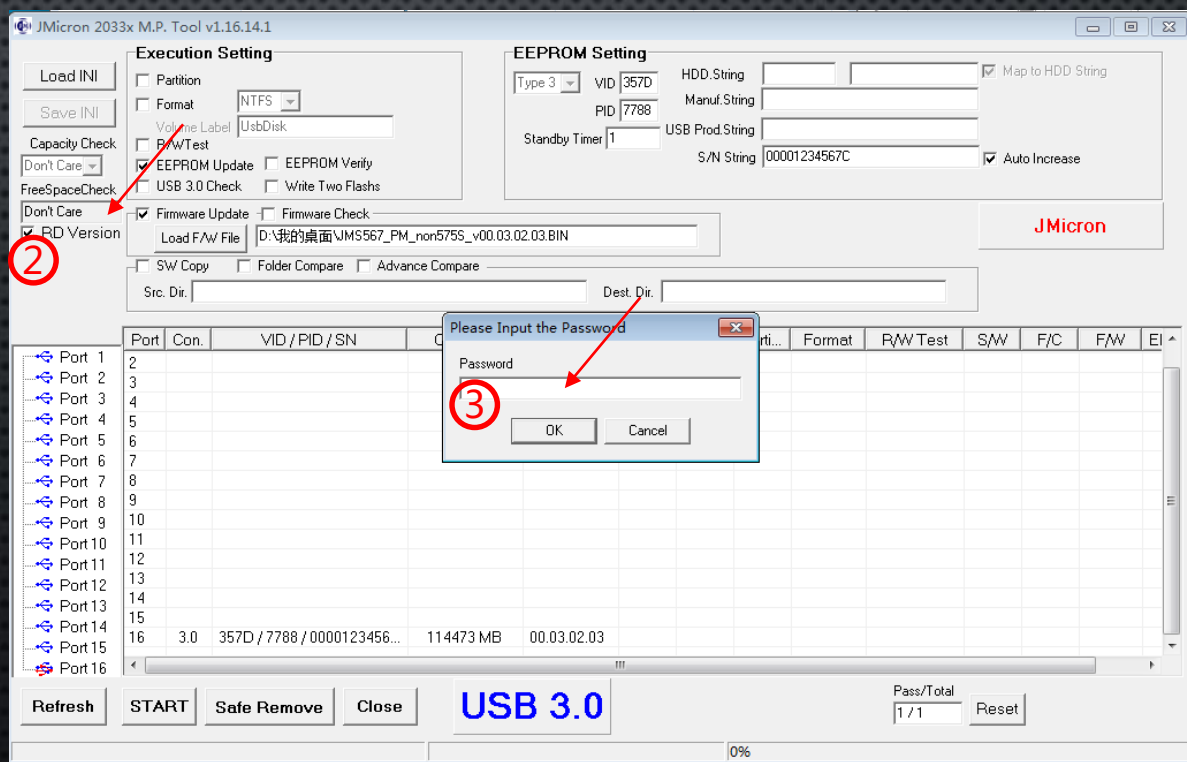


步骤三：输入密码：jmicron

Step 3, Enter the password: jmicron


步骤四：点击 “Load F/W File” 加载固件。

Step 4, Click "Load F / W File" to load the firmware file.

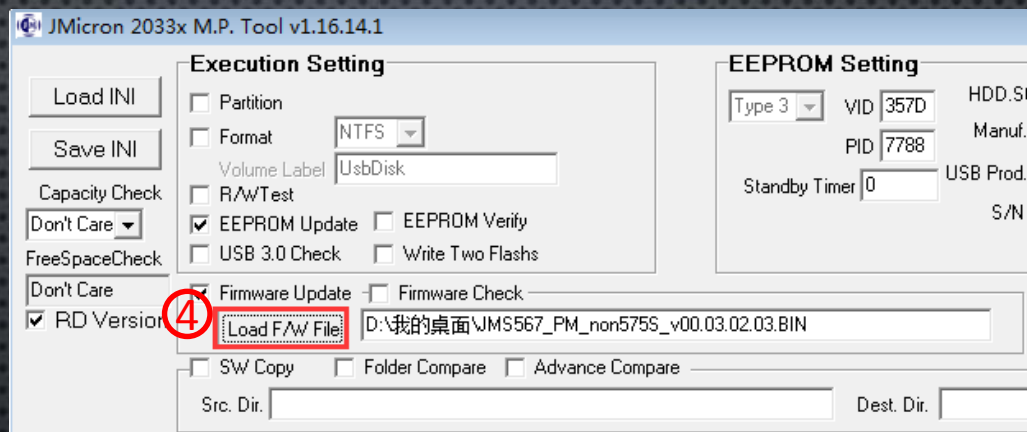


步骤五：打开 “Firmware” 文件夹，选定文件 “ JMS578_STD_v00.02.00.02_BUSPower ” ，点击 “打开” 。

Step 5, Open the "Firmware" folder, select " JMS578_STD_v00.02.00.02_BUSPower " file.



步骤六：点击“START”开始刷新固件，提示PASS，表示刷新固件成功。

Step 6,Click “START” to start refreshing the firmware, suggesting that PASS, that refresh the firmware success .

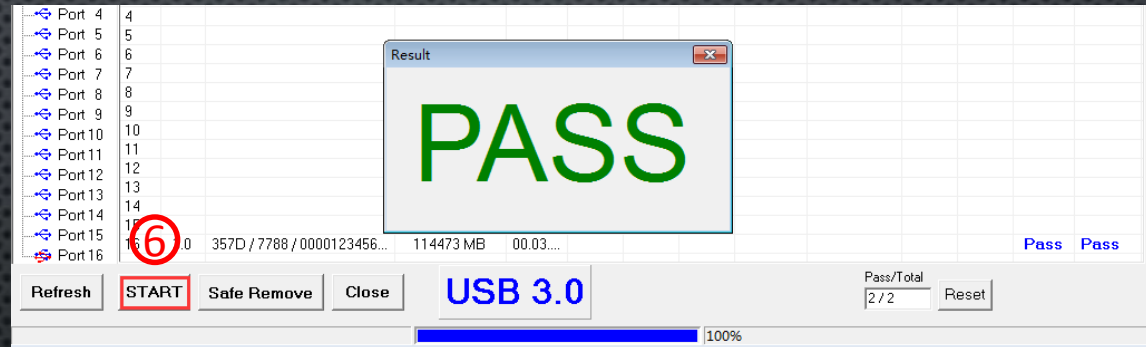

步骤七：重启设备生效！

Step 7, Reboot the device to take effect !

Any comments?
Just contact us
Thanks

ORICO Technologies Co.,Ltd

Email: supports@orico.com.cn

<http://www.orico.com.cn>

<http://www.orico.cc>